



# **EUROPEAN TECHNICAL CENTER**

## FIRMWARE RELEASE NOTE

## Two-Wire IP Video Intercom Firmware Release Notes Build 180821

Supported Models DS-KH8340-TCE2	Firmware Version	DZ20171020_052_21_E3_EN_STD_V1.4.45_180821.zip
Supported Models DS-KV8103-IME2	Firmware Version	DZ20171020_052_21_A1_EN_STD_V2.0.0_180821.zip
iVMS4200 Version		V2.7.1.9 build 20180604

**Note:**


❖ After upgrading to new firmware, manually restore default setting for fully upgrade.

**Reason of Upgrade**

Added or modified functions, enhance products quality and meet customers' requirements

**New Features**

1. Added Czech, Dutch and Polish languages for GUI and voice prompts.
2. Added Enable 2-way audio button in live view:

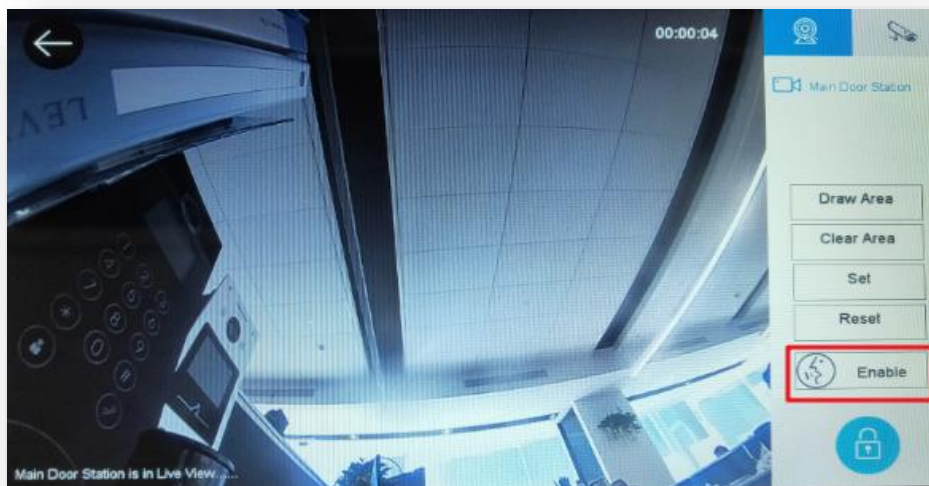


3. DHCP can be enable and disabled (enabled by default).
4. The door station will follow the same DHCP status as the main indoor station.

**5. Added additional door station settings in the SADP menu.**

In Settings->Configuration->SADP click the "More" button next to the door station to configure:

- Microphone volume
- Call Volume
- Beep (system sounds) volume
- Call forwarding delay to the Hik-Connect app

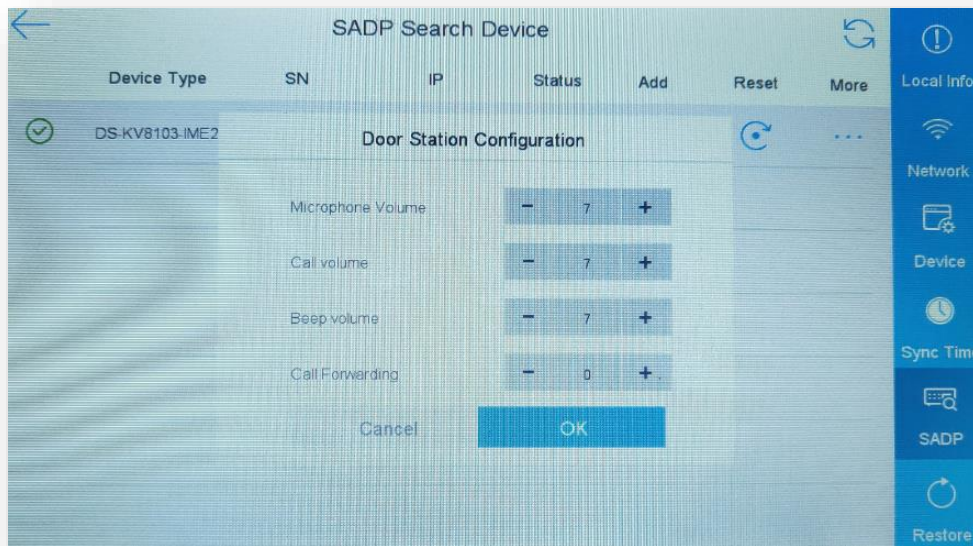

**6. "More" and "Reset" buttons in SADP menu of the indoor stations are disabled for Indoor extensions.**

**7. If the call button is pressed several times during the first 4 seconds the call will not be canceled.**

**Bug Fixes**

1. Fixed incorrect language translations and displaying errors.
2. Fixed system audio playing bug.
3. Fixed indoor station's frequently rebooting bug.
4. Fixed the bug where connection between door and indoor station will take too long when there is no LAN connection (no DHCP server).

## **Customer Impact and Recommended Action**

This new firmware upgrade is to improve product performance, and will take effect automatically after upgrading from previous versions. We'd like to inform you for the above changes. Also, we are sorry for any possible inconvenience of use-habit changes caused by this action.

For questions or concerns, please contact our local technical support team.



### **Note:**

Hikvision has all rights to alter, modify and cancel this notice.

Hikvision doesn't give any guarantee for old models' stock.

Hikvision is not liable for any typing or printing errors.

For special model's change details, please contact our local technical support team.

Hikvision Digital Technology CO., Ltd.  
No. 555 Qianmo Road, Binjiang District, Hangzhou  
310052, China  
Tel: +86-571-8807-5998  
FAX: +86-571-8993-5635