

No: 2017-1185



中国认可
检测
TESTING
CNAS L0461



(2015)国认监认字(182)号 2015001000Z

TEST REPORT

Equipment under Test: Vehicle Camera

Model Number: AE-VC122T-ITSX

Manufacturer: Hangzhou Hikauto Technology Co., Ltd

**National Computer Peripheral Equipment Quality
Supervising Test Center**




仅限Hikvision Europe使用, 其他项目无效, 有效期截止2019-01-25


National Computer Peripheral Equipment Quality Supervising Test Center

Test Report

No:2017-1185

Product	Vehicle Camera	Model type	AE-VC122T-ITSX
		Trademark	—
Entrusted By	Hangzhou Hikauto Technology Co., Ltd	Testing Type	Entrustment
Manufacturer	Hangzhou Hikauto Technology Co., Ltd	Sample Class	—
Sample Origin	Delivered	Delivery Date	2017.05.19
Sample Number	One set	Delivered by	Peng Shujin
Sample Radix	—	Manufacture Date	—
Test Standards	IEC 62262-2002 Degrees of protection provided by enclosures for electrical equipment against external mechanical impacts(IK code) GB/T20138-2006 Degrees of protection provided by enclosures for electrical equipment against external mechanical impacts(IK code)		
Test Items	IK08 hammer test		
Test Result	This test proved that the AE-VC122T-ITSX Vehicle Camera manufactured by Hangzhou Hikauto Technology Co., Ltd complied with the Test Standard.		
Remark	 Issue Date: June 14, 2017		


Approved by:



Checked by:



Chief tester:

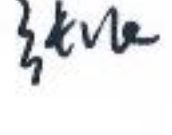


Test Site	National Computer Peripheral Equipment Quality Supervising Test Center				
Test Date	2017.6.13				
Main Testing Equipments and Instruments	S/N	Description	Model	No.	Remark
	1	Falling ball impact test machine	—	HJ0057	
Sample Number	1#: No Product S/N				
Distribution Of Sample	1#: Environment Compatibility Test				
Remark	Climatic conditions: Ambient temperature: 15°C~35 °C Relative humidity: 45%~55% Atmospheric pressure: 86 kPa~106kPa				

Test Items	Technical specifications	Result
		1#
IK08 hammer test	<p>Impact hammer weight : 1.7kg (Equivalent to 5J impact energy)</p> <p>Test height: 300mm</p> <p>Number of tests : 3</p> <p>Test mode: free fall</p> <p>Test position: the protective cover for lens</p> <p>After the test, there is no damage on the structure, and all functions of the equipment remain normal.</p>	Pass
Remark	Test pictures please refer to the following pages.	

Tester: Jin Zhenxi Xu Yangkun

EUT picture

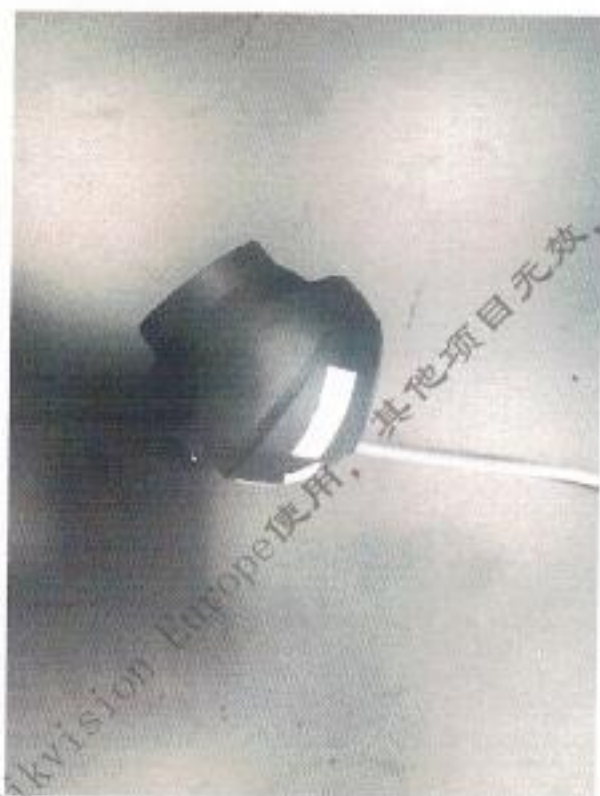

Before the test



During the test



After the test



The sample is intact

仅限Hikvision Europe使用, 其他项目无效, 有效期截止2019-01-25

NOTES

1. Reports with no signet of “test report” or that of the inspect institute are all invalid.
2. Partial copy of this report is forbidden. Entire copy of the report without signet is invalid.
3. Report with no approval are invalid.
4. Altered report is invalid.
5. If any disagreement on this report, a written claim is requested to be submit to the institute within 15days on receipt of the report.
6. Generally, authorized inspection is only responsible for the samples inspected.

Address: 36#, Macheng Road, Hangzhou, China

Tel: +86 571 88278723 +86 571 88828284

Fax: +86 571 88366821

P. O. Box: 1215#, Hangzhou, China

Zip Code: 310012

E-mail: wangwx@ksign.cn

WEB: www.ksign.cn